

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: D-311

No. 313

Subject: Discs Do Not Play.

Date: January 12, 1993

Symptom:
(51)


The PD signal lead of the flex cable shorts to the clamp which secures the flex cable to the optical assembly. This prevents the disc from playing.

Solution: Replace the clamp with an improved type.

REF	DESCRIPTION	PART NUMBER
-	FLEX CABLE HOLDER	2-625-775-03

Note: Some optical assemblies have been manufactured with the improved clamp. These assemblies can be identified by an orange mark on the clamp.

Applicable serial numbers: 10001 - 313400

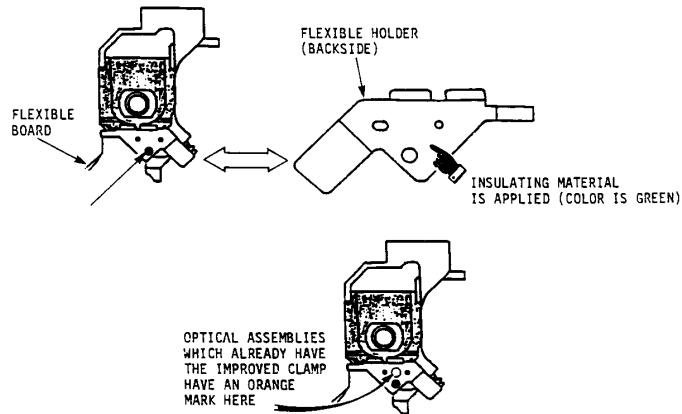

Reference: Tech. News GA92046



PRINTED IN U.S.A.
CSA-131292-10

Portable Disc Player
CSA-13