

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: D-311

No. 315

Subject: Incompletion Of Full Charge


Date: January 12, 1993

Symptom:
(**)

Charge lamp lights on momentarily when charge button is pressed but full charge has not been completed.

- Solution:**
1. Check the VCC of microprocessor using the terminals of C801.
 2. If it is less than 3.45V, change the value of R424.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R424	METAL CHIP 100KOHMS	1-218-740-11	METAL CHIP 75KOHMS	1-218-296-11

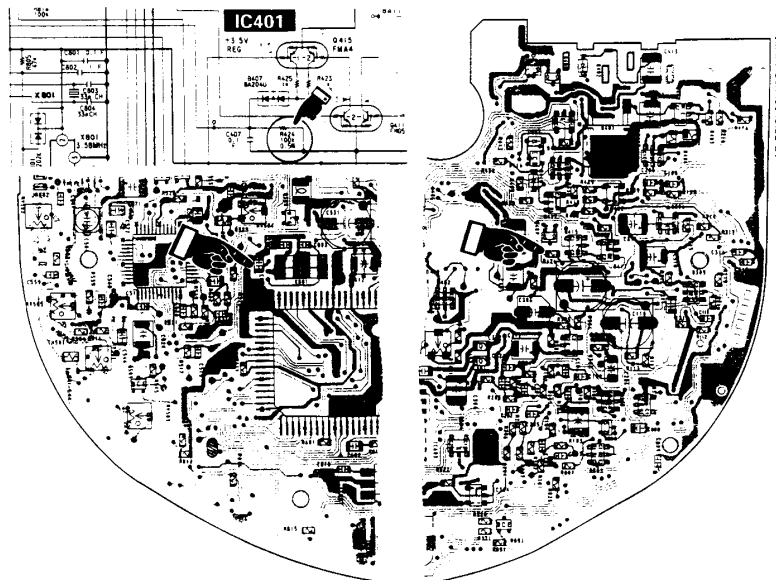

Portable Disc Player

CSA-1

Reference: Tokyo Fax GA92051



PRINTED IN U.S.A.
CSA-13193-2