

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company · Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-C515 / C615 / C67ES

No. 318

Subject: Popping noise in audio when using the optical output and the unit is taken out of pause when in the play mode. **Date:** February 5, 1993

Symptom:
(54)

When the unit is connected through the digital optical output, a popping noise can be heard intermittently in the audio when the unit is put into pause or taken out of pause during the play mode.

Solution:

The problem is caused by a programming error between the CXP50116-213Q System Controller IC and the CXD2500AQ DSP IC. Replace the DSP IC (IC301) with the new type as shown in the chart below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC301	CXD2500AQ	8-752-337-26	CXD2500BQ	8-752-352-93

CSA-13 CD Player