

**SONY.**

Hi-Fi Products  
**Service Bulletin**

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDP-C225 / C325 / C425

**No. 319**

**Subject:** Portions Of The Display Are Constantly Lit

**Date:** February 10, 1993


**Symptom:**  
(13)

Portions of the display are constantly lit when the unit is powered on. The Main PC board becomes loose from the finger snap hold down which holds it to the chassis. This results in the Main PC board shorting to the bottom metal case which causes problems with the display.

**Solution:**

Snap the Main PC board back onto the finger snap hold down and add a screw (type shown in the chart below) at the location shown in the drawing below.

DESCRIPTION	PART NUMBER
SCREW TAP +BV 3.0X8.0 BLK	7-685-646-79

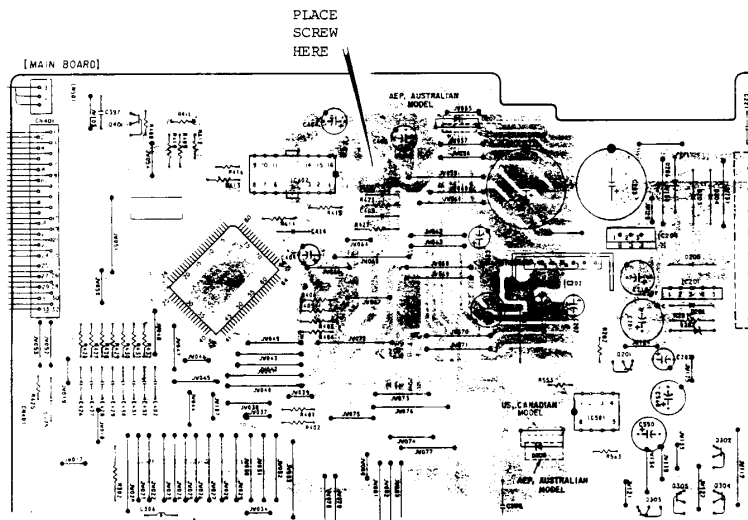

CSA-13 CD Player

Reference: FPR-N2496  
Auto-Flagging: YES

PRINTED IN U.S.A.  
CSA -13193-7