

**SONY**

Hi-Fi Products  
**Service Bulletin**

Sony Service Company Technical Services  
 A Division of Sony Corporation of America  
 Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDP-H3600

**No. 324**

**Subject:** Disc Drawer Will Not Open And/Or Close.

**Date:** February 26, 1993


**Symptom:**  
 (61)

The disc drawer does not open and/or close when the Open/Close button is pressed.

**Solution:**

After making sure that the problem is not caused by something else, replace CD system control IC-202. To prevent the problem from reappearing, add 1K resistors in series with the IN SWITCH and OUT SWITCH inputs of IC-202, pins 27 and 28. These pins must be lifted off the surface of the board.

REF	DESCRIPTION	PART NUMBER
-	RESISTOR, CARBON 1K (1/6W)	1-247-831-00
IC-202	IC, UPD75116GF-760-3BE	8-759-153-16

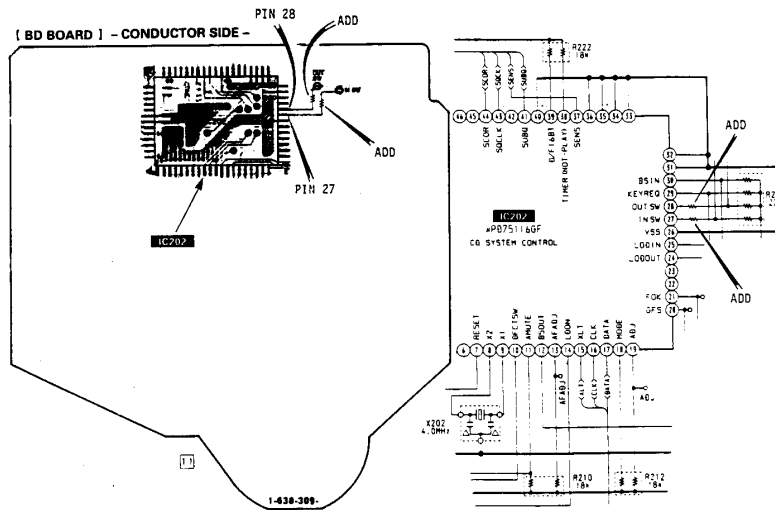

CSA-13 CD Player