

CONFIDENTIAL

CSA-13

Sony Service Company
National Technical Services
A Division of Sony Electronics Inc.
Park Ridge, New Jersey 07656

Service Bulletin Hi-Fi Products

Model: TA-AV521, TA-AV621

No. 341R1

Subject: Audio Cuts Out, Unit In Protect - R807 & R857

Date: August 9, 1996

Symptom:

(51)

When operating in the SIMULATED or HALL SURROUND MODE, the Rear level is set to 50% maximum level or greater and the Master Volume is turned up, the unit goes into protect.

Solution:

Verify that the unit is being operated with speakers rated at 8 ohms. If the unit goes into protect with 8 ohm speakers then replace resistors R807 (Rear Board) and R857 (Center Board) with the resistors shown in the chart below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R807	220 OHM, 5%, 1/4W	1-249-409-11	560 OHM, 5%, 1/4W	1-249-414-11
R857	220 OHM, 5%, 1/4W	1-249-409-11	220 OHM, 5%, 1/4W	1-249-414-11

