

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: D-35


No. 342

Subject: CD Stops When The Display Changes In Battery
Use - Replace IC-801

Date: May 5, 1993

Symptom:
(12)

 CD stops when the display for the remaining battery capacity changes as following in battery use.



Solution: Replace IC-801 with an improved type.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC-801	CXP5078-029Q	8-752-811-73	CXP5078-059Q	8-752-817-68

Applicable Serial Nos: 154700 and earlier



PRINTED ON RECYCLED PAPER

Reference: Tokyo Fax GA-93001
Autoflagged - NO

PRINTED IN USA
CSA-13593-1