

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: TC-W32

No. 343

Subject: Oscillation in Deck "B"

Date: May 28, 1993


Symptom:

(54) Oscillation occurs on the output of Deck "B" and the level meters peak when playing back certain tapes in the Dolby "C" mode. This occurs on tapes containing a strong signal level (ie. Metal type tapes).

Solution:

The wire for the Headphone output is positioned too close to the tape deck head wire. Reposition the Headphone output wire so that it is away from the head wire (see layout below for details).

Applicable Serial Numbers: Up To 805,500

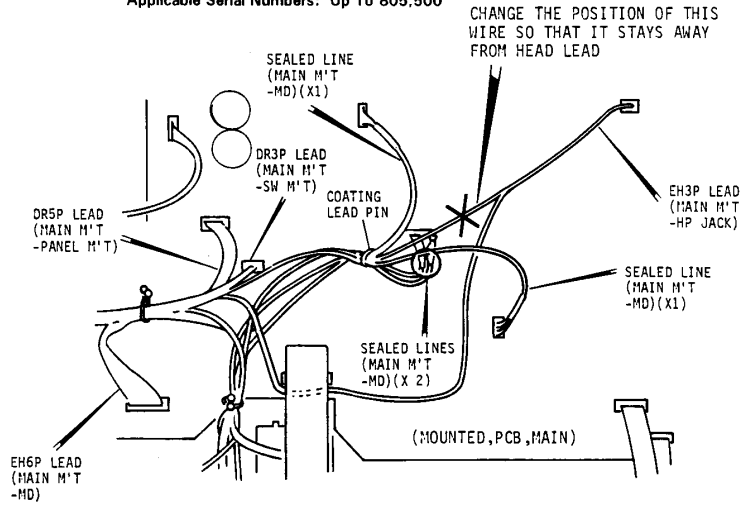

Reference: FPR-O1521
Autoflagged - NO



PRINTED IN USA
CSA-13593-2