

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: MDS-101; MZ-1

No. 347

Subject: Automatic Track Numbering Does Not Work
When Recording From A Multi-Disc Player
Through The Digital Input.

Date: August 9, 1993

Symptom:
(22)

The automatic track numbering feature does not work when recording from a Multi-Disc Player. Instead, the audio is recorded as a single track, even though the source disc contains multiple tracks. This problem has been observed when using both Sony and non-Sony Multi-Disc Players; however, the solution below only applies to the following Sony Multi-Disc Players:

MDP-210/333/510/605

Solution:

Connect pin 21 of the Multi-Disc Player's Audio DSP IC to ground by adding a jumper wire. The Audio DSP IC used in the above models may be either of the following two types:

REF	DESCRIPTION	PART NUMBER
-	IC, CXD1125	8-752-331-34
-	IC, CXD1165	8-752-325-59

