

SONY

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-C701/801ES

No. 362

Subject: Intermittent Pop Noise in Left Channel Output

Date: November 30, 1993


Symptom:
(54)

Intermittently, a "pop" or "snap" noise may be heard in the left channel of any output, either fixed line, variable line or headphone on some units. It is most noticeable during very quiet passages or in-between tracks. It is not dependent on the disc being used.

Solution:

Add a capacitor as shown below. The units with Serial Numbers higher than those listed below already have the capacitor added. Some units below the listed Serial Numbers may also have the capacitor added. Be sure to check before adding.

REF	DESCRIPTION	PART NUMBER
NONE	22PF CERAMIC CAPACITOR	1-162-207-31

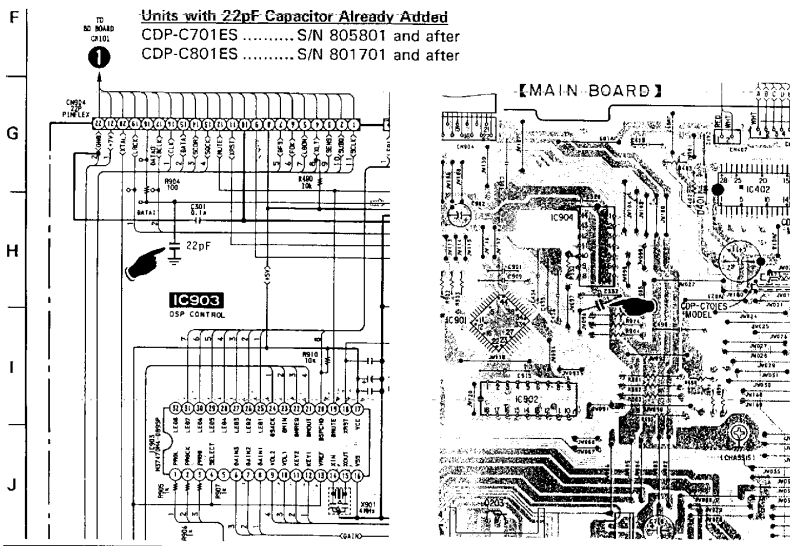

Reference: Tokyo AU/QA Fax MS-9363
Autoflagged - YES



PRINTED ON RECYCLED PAPER

PRINTED IN USA
CSA-131193-3