

SONY

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-H3600

No. 367

Subject: Preventing Damage To Q101

Date: January 30, 1994

Symptom:


(**) The unit has no power because Q101 on the Main MCB is damaged.

Solution:

Replace Q101, and prevent it from being damaged again by adding a 0.1µF capacitor across its base and emitter.

This capacitor has already been mounted on *some* version "A" Main boards, and *all* version "C" Main boards. Version "A" Main boards are silkscreened with the number 1-638-990-__; version "C" Main boards are silkscreened with the number 1-640-541-__. Add the capacitor only to version "A" Main boards which do not already have the capacitor mounted.

REF	DESCRIPTION	PART NUMBER
Q101	TRANSISTOR, 2SB1122S	8-729-804-41
-	CAPACITOR, CHIP, 0.1µF	1-163-038-00

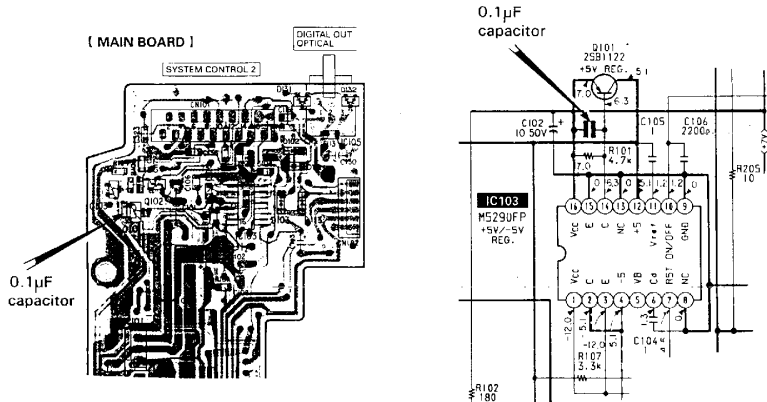

Reference: FPR-O1031
Autoflagged - NO



PRINTED IN USA
CSA-13194-1