

SONY.

Hi-Fi Products

CSA-13

Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: D-121

No. 373

Subject: No Power and/or No Hold

Date: February 18, 1994


Symptom:

(11) No power with AC Adaptor, no battery power, no hold.

Solution:

1. Check hold switch visually, and if it appears to be out of alignment or cold soldered, then realign and resolder hold switch (S801).
2. Pull out the DC Jack board and check it visually. If any of the traces are damaged, then replace the DC Jack board.

REF	DESCRIPTION	PART NUMBER
S801	SWITCH, SLIDE (HOLD)	1-570-397-11
	DC JACK BOARD	1-647-242-11

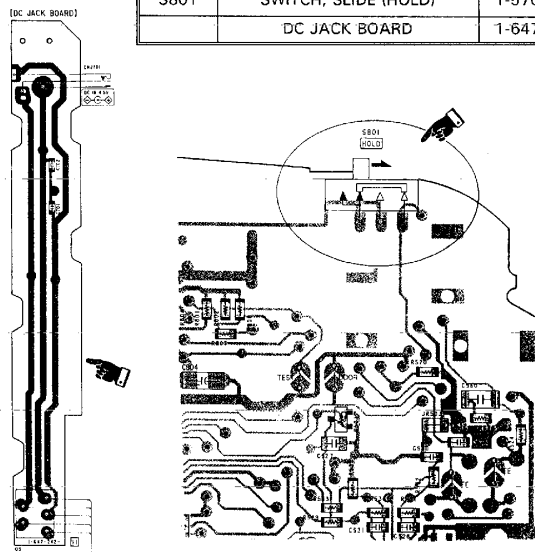

Reference: FPR-03195
Autoflagged - NO



PRINTED IN USA
CSA-13294-1