

**SONY**

Hi-Fi Products

**CSA-13**

## Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** D-121/125

**No. 376**

**Subject:** Optical Flexible Board Jamming Sled

**Date:** February 28, 1994


**Symptom:**  
(62)

The flex cable from the optical assembly gets jammed under the slide mechanism and prevents it from coming "home" to read TOC.

**Solution:** Attach a lumilar sheet to the optical flexible board as shown.

REF	DESCRIPTION	PART NUMBER
-	LUMILAR SHEET	4-956-818-01

Applicable serial numbers: 432240 and lower

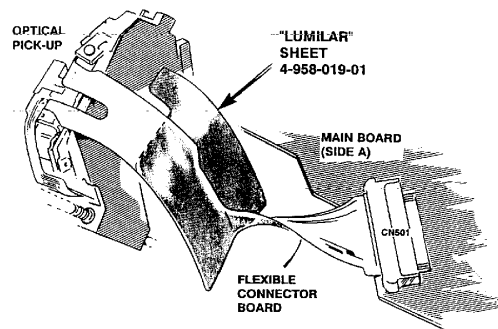

Reference: FPR-O3337  
Autoflagged - NO

PRINTED IN USA  
CSH-13294-5