

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MHC-2750
MHC-3750

No. 379

Subject: Distorted Audio on Dubbed Tapes

Date: March 4, 1994

Symptom:

(53)

When a tape is dubbed from a tape that was recorded from a CD, the dubbed tape's audio distorts.

Example: A CD is copied to tape A, tape A is dubbed to tape B, the audio on tape B is distorted (the level of tape B may be too high).

Solution:

1) Switch Dolby off, then input a 315Hz 0dbm signal to DAT IN. With the Function switch set to MD/DAT record the signal on a CS-123 test tape.

2) Playback the tape you recorded in the previous step on deck B. Adjust RV201 and RV301 on the TC MAIN BD so the signal at DAT OUT is -11dbm.

Applicable Serial numbers for MHC-2750, 800001 - 853100
Applicable Serial numbers for MHC-3750, 800001 - 811100

Reference: Technical News AU-93024
Autoflagged - NO



PRINTED IN USA
CSA-13294-11