

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MHC-2750

No. 383


Subject: Tuner Crosstalk at Phono Input

Date: March 18, 1994

Symptom:
(53)


Tuner crosstalk at the Phono input.

Solution: If the customer complains of tuner crosstalk or bleedthrough on the phono input perform the following countermeasure.

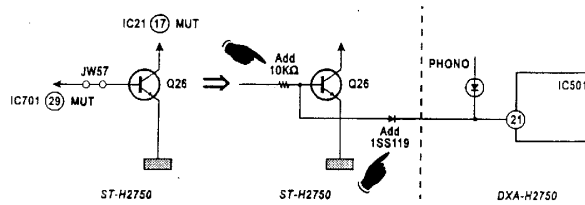

ST-H2750

- 1) Remove JW57 and insert a 10K ohm 1/4W resistor (1-249-429-11) in its place.
- 2) Add a 1SS119 diode (8-719-911-19) and a wire to pin 5 of CNJ601 (connector board) as shown.

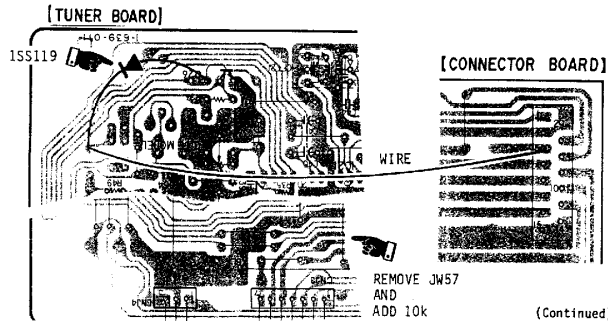

(Continued)

Reference: Europe - HF00194
Autoflagged - NO



PRINTED IN USA
CSA-13394-3

DXA-H2750

- 1) Add a wire from CN505 pin 11 (Control Board) to CN101 pin 11 (Main Board) as shown.

