

**SONY.**

Hi-Fi Products  
**Service Bulletin**

**CSA-13**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDP-C235  
CDP-C335

**No. 390**

**Subject:** Motor Drive Circuit Modification

**Date:** April 26, 1994

**Symptom:**  
(62)

The BU assembly contacts the disc tray when attempting to load a disc.

**Solution:** Replace IC401 with the part listed below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC401	CXP82316-020Q	8-752-843-25	CXP82316-026Q	8-752-849-42

Verify the value of the following 1/4 watt resistors:

R457	2.4K ohm	P/N 1-247-840-00
R458	750 ohm	P/N 1-247-828-11
R459	1.2K ohm	P/N 1-249-418-11

If resistors of a different value are currently installed in these locations remove them, and replace with the proper value.

Applicable Serial numbers for CDP-C235, after 877658

Applicable Serial numbers for CDP-C335, after 854051

