

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MHC-510

No. 393

Subject: Two Versions of Display/Function Control IC501 **Date:** May 13, 1994


Symptom:
(**)

There are two versions of the Display Controller IC501, μ PD78042-GF-028 (8-759-173-77) and μ PD78042-GF-0213BQ (8-759-088-85). The difference between the two versions is as follows:

μ PD78042-GF-0213BQ: R5001 and R5002 are NOT included.

μ PD78042-GF-028: R5001 and R5002 are included.

Solution: When using P/N 8-759-088-85 listed in the Service Manual, the 47K ohm resistors R5001 and R5002 (P/N 1-249-437-11) need to be added between pins 69 and 70 of IC 501 and VLOAD (pin 71 of IC501). If these resistors are not added the display will flicker.

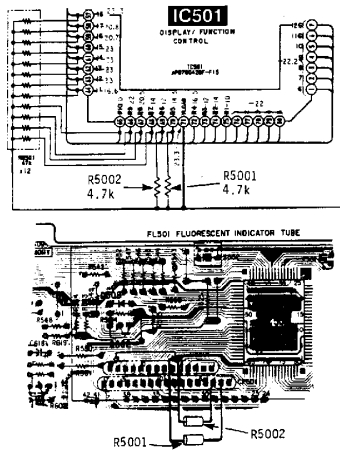

Reference: Sony Europe S/B HF00994
Autoflagged - NO



PRINTED IN USA