

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: SA-VA3

No. 398

Subject: Fluorescent Display shuts off.
Serial numbers 823103 - 823918

Applicable

Date: June 24, 1994


Symptom:
(**)

The fluorescent display FL801 will turn off in 3 to 5 minutes after the power is turned on

Solution:

Add the missing diode, listed below, to the fuse board.

REF	DESCRIPTION	PART NUMBER
D953	DIODE, RD36S-B	8-719-158-82

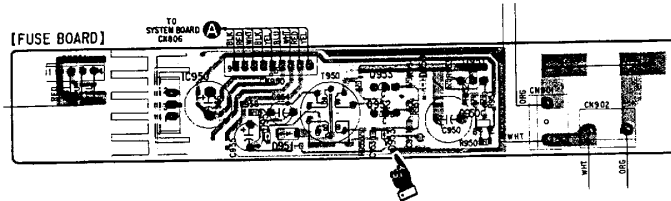

Reference: Tech News AU-94014
Autoflagged - NO



PRINTED IN USA