

SONY.

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: DTC-2000ES


No. 399

Subject: Fluorescent Display shuts off
Applicable Serial #'s up to 250751

Date: June 24, 1994

Symptom:
(13) The Fluorescent display intermittantly shuts off.

Solution: Add a 100k ohm pull up resistor (1-247-879-11) from IC403 pin 51 to +5v line. See diagram below.

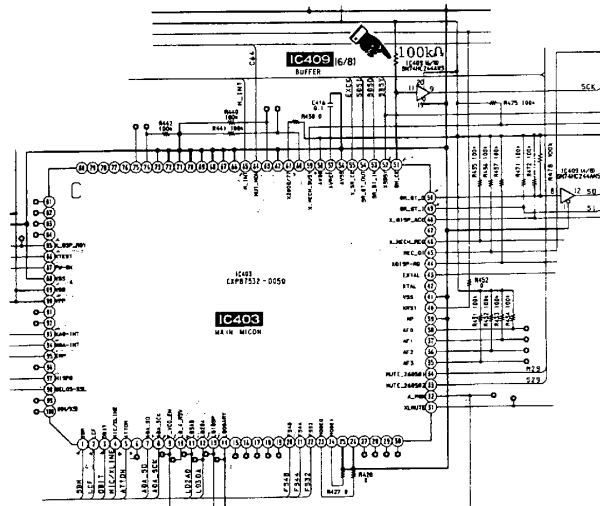

Reference: Technical News TCO-93009
Autoflagged - NO



PRINTED IN USA