SONY®

Hi-Fi Products Service Bulletin



Sony Service Company - Technical Services A Division of Sony Electronics Inc. Sony Drive, Park Ridge, New Jersey 07656

Model: DSC-88 (SERVICE JIG FOR DTC) No. 400

Subject: Countermeasure for noise from A/D converter **Date:** November 21, 1995

Symptom:

(54) During the operation of Digital Signal Checker (DSC-88) noise is heard in the audio.

Solution: Connect a 0.1 mf (1-136-165-51) between pin 19 on IC CS5326VP and ground of

C65. Also connect 0.1mf capacitor between pin 25 on IC CS5326VP and ground of

C56 as shown below.



Audio Products Service Bulletin No. xxx