

SONY.

Hi-Fi Products
Service Bulletin

CSA-13


Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: FH-B5CD/B50CD/B150, MHC500/1100 **No.** 401
HCD-H5/H50/H55/H500/H1100

Subject: Distorted recordings from CD **Date:** June 24, 1994

Symptom:
(53) A recording from a CD may sound distorted during playback.

Solution: Add two 4.7K 1/4 W resistors (1-249-425-11) between IC705 pins 5 and 14 to ground.
See diagram below.

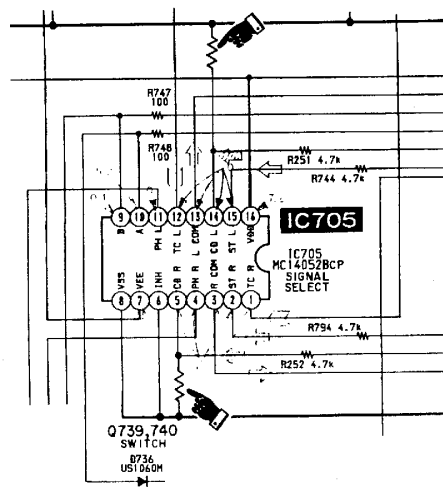

Reference: Technical News AU-94010
Autoflagged - NO



PRINTED IN USA