

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-CX100\100S

No. 402

Subject: Remote control malfunctions/Long play CD's won't play. Applicable Serial #'s up to 201499

Date: June 24, 1994

Symptom:
(25)

- 1.) When CDP-CX100 is connected to a DST system(DLS-M1/L1 or TA-DM1000ES) and the AMS function is accessed through the handheld remote, the CDP-CX100 will skip two tracks on the disc.
- 2.) The unit will not play discs with 32 songs.

Solution:

Replace IC801 with the improved IC listed below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC801	MB89646PF-104	8-759-182-58	MB89646PF-109	8-759-266-48
IC801	MB89646PF-107	8-759-254-83		

