

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: D-335, TCD-D7

No. 419

Subject: No Digital Recording

Date: December 27, 1994

Symptom:

(55)

Digital recording is impossible when connecting D-335 to TCD-D7 using an optical connection cable.

Solution:

Apply the following changes on the Main Board of D-335.

1. Replace the Ceramic Oscillator X301 with a Crystal oscillator.
2. Add 2 capacitors.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
X301	CERAMIC OSCILLATOR	1-760-404-11	CRYSTAL OSCILLATOR	1-567-908-11
C391/ C392	-	-	15PF/50V CERAMIC CHIP CAPACITORS	1-162-917-11



