

SONY.

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MDS-501

No. 435

Subject: The Input Source sound level is reduced when power is switched off

Date: March 16, 1995

Symptom:
(52)

When the Rec-Out of an amplifier is connected to the Line-in of the MDS-501, the sound level of the input source may drop when power to the MDS is switched off.

Solution: Replace the following resistors located on the AU board:

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R571	470 OHM 1/6W RESISTOR	1-259-420-11	10K OHM 1/6W RESISTOR	1-259-452-11
R572				

