Hi-Fi Products Service Bulletin



Sony Service Company - Technical Services A Division of Sony Electronics Inc. Sony Drive, Park Ridge, New Jersey 07656

Model: D-137CR No. 438

Subject: No Sound Date: May 15, 1995

Symptom:


(154) No Sound is heard, only noise.

Solution: Cracks in the solder of C559 are caused by stress on the board from the front

cabinet.

• Resolder C559 on the main Board. (section F-8 on the physical diagram)

• Cut the Front cabinet, as shown in the diagram below to help relieve the stress.

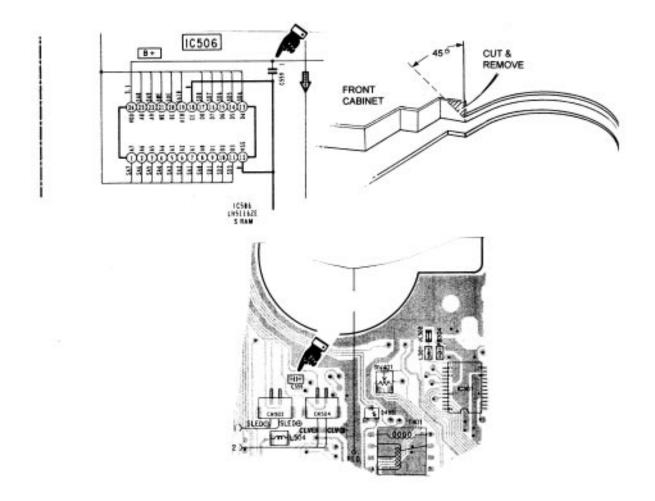

Audio Products Service Bulletin No. xxx

Filename: HFP0438.SB

Directory: J:\SBDOC\MAY95

Template: C:\WINWORD\TEMPLATE\S_BULL.DOT

Title: No Sound or only noise

Subject: d137cr

Author: Hoyt Wing Lee

Keywords: Comments:

Creation Date: 05/15/95 8:21 AM

Revision Number: 2

Last Saved On: 05/15/95 8:21 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes

Last Printed On: 04/01/96 9:46 AM

As of Last Complete Printing Number of Pages: 2

Number of Words: 114 (approx.)

Number of Characters: 650 (approx.)