

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-X779ES

No. 448

Subject: Intermittant Lock-up of Functions

Date: September 13, 1995


Symptom:

(57) The customer will complain that the unit will intermittantly not operate.

Solution:

Replace System Control IC801 with the improved version MSC62408-101GS-V1K. The part number for the improved part is 8-759-167-74.

Note: Before replacing IC801 check connectors CN801 and CN301. Poor contact between the Master system controller and the Subsystem controller will cause similar symptoms.

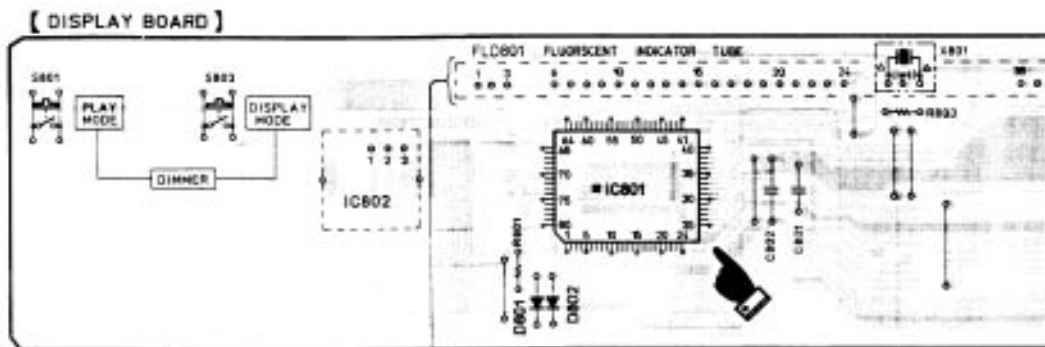

Filename: HFP0448.SB
Directory: J:\SBDOC\SEP95
Template: C:\WINWORD\TEMPLATE\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 09/13/95 11:16 AM
Revision Number: 3
Last Saved On: 09/13/95 11:16 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes
Last Printed On: 04/01/96 11:03 AM
As of Last Complete Printing
Number of Pages: 1
Number of Words: 135 (approx.)
Number of Characters: 772 (approx.)