

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: TA-AV531, TA-AV631X

No. 452

Subject: Resistors Missing on Main PC Board

Date: November 10, 1995

Symptom:

(****)

During the production phase of the TA-AV531 and TA-AV631X, R743 and R744 may not have been installed* on the Main PC board.


Solution:

When a TA-AV531 or 631X is in for service, for any reason, verify that R743 and R744 have been mounted on the main board. If not already installed, mount the resistors on the board. If you must replace the Main PC board on either of the above models, check the board for missing resistors before installing. The part numbers for the main boards are A-4360-464-A (TA-AV531), and A-4365-074-A (TA-AV631X). The resistor part numbers are listed below.

REF	DESCRIPTION	PART NUMBER
R743	47K OHM RESISTOR	1-249-465-11
R744	3.3K OHM RESISTOR	1-247-719-11

*Applicable serial number range: TA-AV531 ~ 8858001 - 8866801

TA-AV631 ~ 8810701 - 8814801

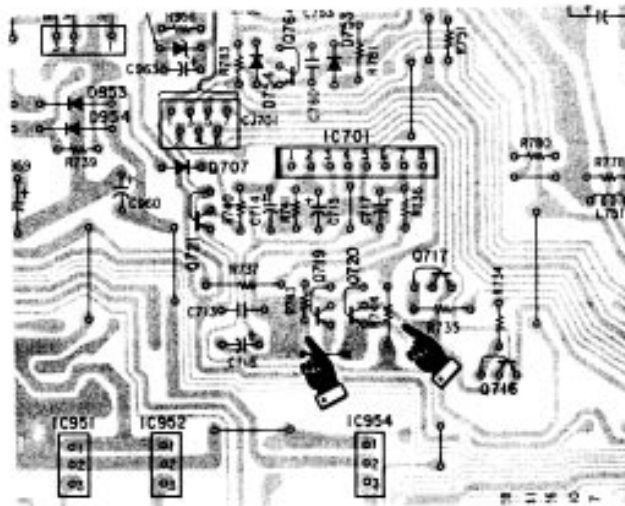

Filename: HFP0452.SB
Directory: J:\SBDOC\NOV95
Template: C:\WINWORD\TEMPLATE\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 11/10/95 11:48 AM
Revision Number: 2
Last Saved On: 11/10/95 11:48 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes
Last Printed On: 04/01/96 10:14 AM
As of Last Complete Printing
Number of Pages: 1
Number of Words: 195 (approx.)
Number of Characters: 1,113 (approx.)