

# Hi-Fi Products Service Bulletin

**CSA-13**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** MHC-C33, MHC-C55

**No.** 453

**Subject:** R503, R504 NEW VALUES

**Date:** October 26, 1995

**Symptom:** Discs Jam, or the Unit May Fail to Identify Discs Properly  
(165)

**Solution:** If a customer complains of this symptom, replace R503 and R504 (on the O/C SW board) with new values to improve the disc detector sensitivity.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R503	300 $\Omega$ ,	1-247-818-11	180 $\Omega$ ,	1-247-813-81
R504	15K $\Omega$ ,	1-249-431-11	33K $\Omega$ ,	1-247-867-81

Note: Units manufactured since June 94 include the new resistors. The serial number range is listed below.

MHC-C33            807075    and up

MHC-C55            827030    and up



Filename: HFP0453.SB  
Directory: J:\SBDOC\OCT95  
Template: C:\WINWORD\TEMPLATE\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 10/26/95 11:01 AM  
Revision Number: 2  
Last Saved On: 10/26/95 11:01 AM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 0 Minutes  
Last Printed On: 04/01/96 10:47 AM  
As of Last Complete Printing  
Number of Pages: 1  
Number of Words: 154 (approx.)  
Number of Characters: 882 (approx.)