

# Hi-Fi Products Service Bulletin

**CSA-13**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDP-C265

**No.** 455

**Subject:** Disc Table will not stop Rotating

**Date:** November 10, 1995


**Symptom:**

**(62)** The disc table (B) rotation speed is too fast and will not stop rotating.

**Solution:**

If this problem is seen, note the serial number of the unit and add the proper resistor in parallel to R459 (1.2K ohm). The additional resistor (listed below) should be added to the foil pattern side of the PCB.

SERIAL NO. RANGE	8000101 - 8000682		8000001 - 8000100 8000683 - 8018074	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
	7.5K OHM	1-247-852-11	12K OHM	1-247-857-11

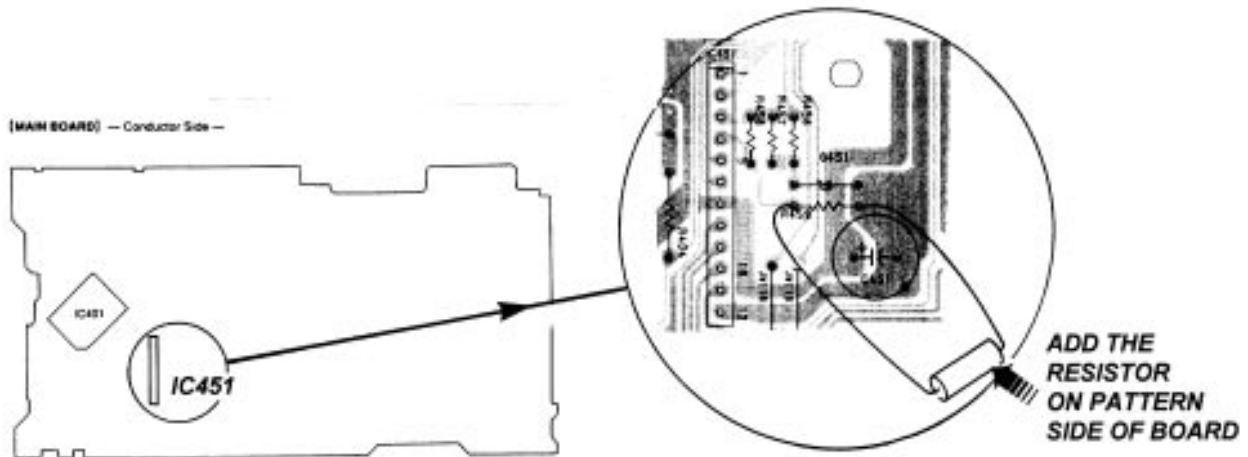

Filename: HFP0455.SB  
Directory: J:\SBDOC\NOV95  
Template: C:\WINWORD\TEMPLATE\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 11/10/95 9:52 AM  
Revision Number: 2  
Last Saved On: 11/10/95 9:52 AM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 0 Minutes  
Last Printed On: 04/01/96 10:16 AM  
As of Last Complete Printing  
Number of Pages: 1  
Number of Words: 147 (approx.)  
Number of Characters: 841 (approx.)