

# Hi-Fi Products Service Bulletin

**CSA-13**

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656


**Model:** HCD-H305, HCD-H405, HCD-H605, MHC-C305, MHC-C405, MHC-C605      **No. 456**

**Subject:** Mis-operation due to wrong position of the disc tray.      **Date:** November 10, 1995

**Symptom:**  
(161) The disc tray may stop during operation.

**Solution:** If a customer complains of this, replace R307 and R308 with the new values to improve tray position sensing circuit.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R307	RESISTOR, 10K $\Omega$	1-249-429-11	RESISTOR, 1.2K $\Omega$	1-249-418-11
R308	RESISTOR, 30K $\Omega$	1-247-866-11	RESISTOR, 15K $\Omega$	1-249-431-11

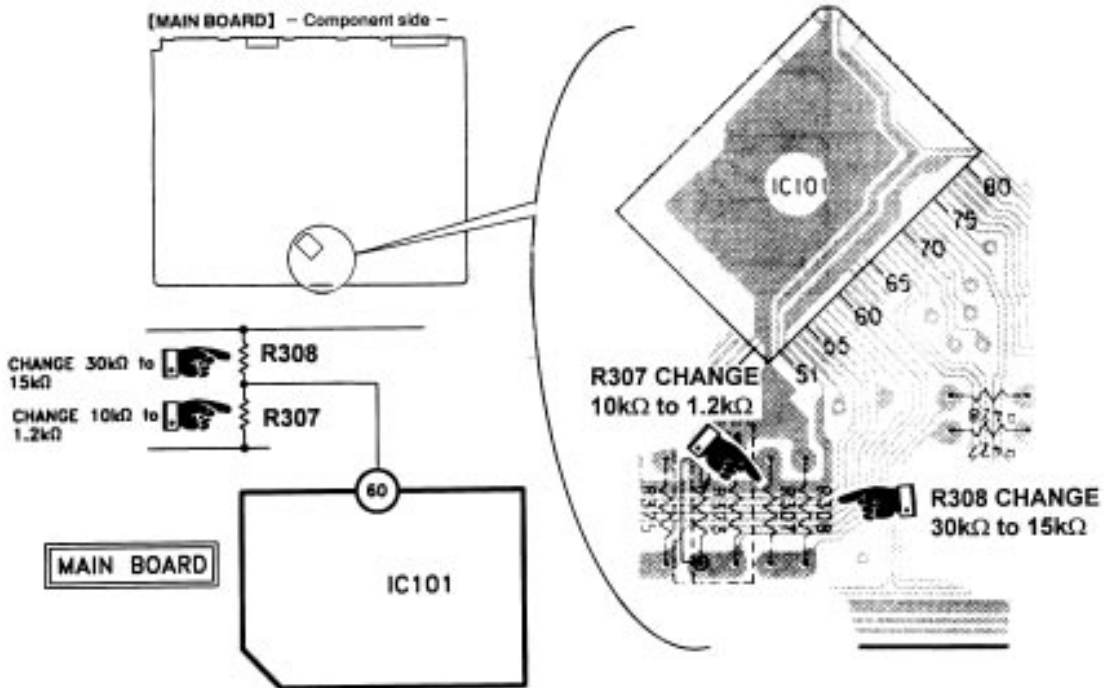



Filename: HFP0456.SB  
Directory: J:\SBDOC\NOV95  
Template: C:\WINWORD\TEMPLATE\S\_BULL.DOT  
Title:  
Subject:  
Author: Hoyt Wing Lee  
Keywords:  
Comments:  
Creation Date: 11/10/95 9:12 AM  
Revision Number: 2  
Last Saved On: 11/10/95 9:12 AM  
Last Saved By: Hoyt Wing Lee  
Total Editing Time: 0 Minutes  
Last Printed On: 04/01/96 10:15 AM  
As of Last Complete Printing  
Number of Pages: 2  
Number of Words: 140 (approx.)  
Number of Characters: 801 (approx.)