

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: HCD-D260, HCD-D560

No. 458R1

Subject: Unable to Operate

Date: February 15, 1996

Symptom:

(212) The unit may become inoperative or may behave erratically.

Solution: Perform the following to improve the main μ -con reset circuit.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R1852	RESISTOR, 3.3K Ω	1-249-423-11	RESISTOR, 22K Ω	1-249-433-11
ADD	-----	-----	CAPACITOR, 4.7 μ F/100V	1-124-927-11

