

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: FH-209W, FH-211W, HST-190, HST-750W,
TC-FX170, TC-FX211, TC-V33W, TC-W255,
TC-W285, TC-W285, TC-W300, TC-W310,
TC-W380, TC-W390

No. 473R1


Subject: Plastic Screw Kit Available for Mounting Tape
Transport Motor

Date: June 14, 1996

Symptom:

(**)

The original Tape transport motor for the listed models is no longer available. Replacement motors are available under the following part numbers: X-3390-801-1, X-3390-802-1, 1-541-427-11, and 1-541-745-11. The negative (minus) side of the replacement motors are internally connected to the motor case. The case ground may damage the negative power supply in a symmetrical +,- power supply configuration.

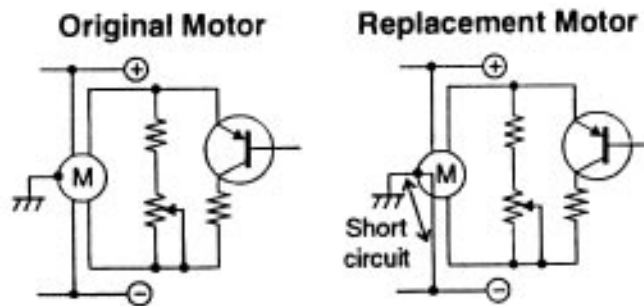

Solution:

Use screw and washer kit, part number X-3371-447-1, when mounting a replacement motor in a model using a symmetrical +,- power supply.

