

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MDS-101

No. 474

Subject: No Playback of MO Discs


Date: March 25, 1996

Symptom:
(51)

MO discs will display irregular movement on playback such as; no rotation, no focus servo, and ejecting. No problem seen when playing pre-recorded non-MO MiniDiscs.

Solution: Replace C259 with the part listed below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
C259	1UF/50V ELECTROLYTIC CAPACITOR	1-126-193-11	1UF/50V ELECTROLYTIC CAPACITOR	1-126-301-11

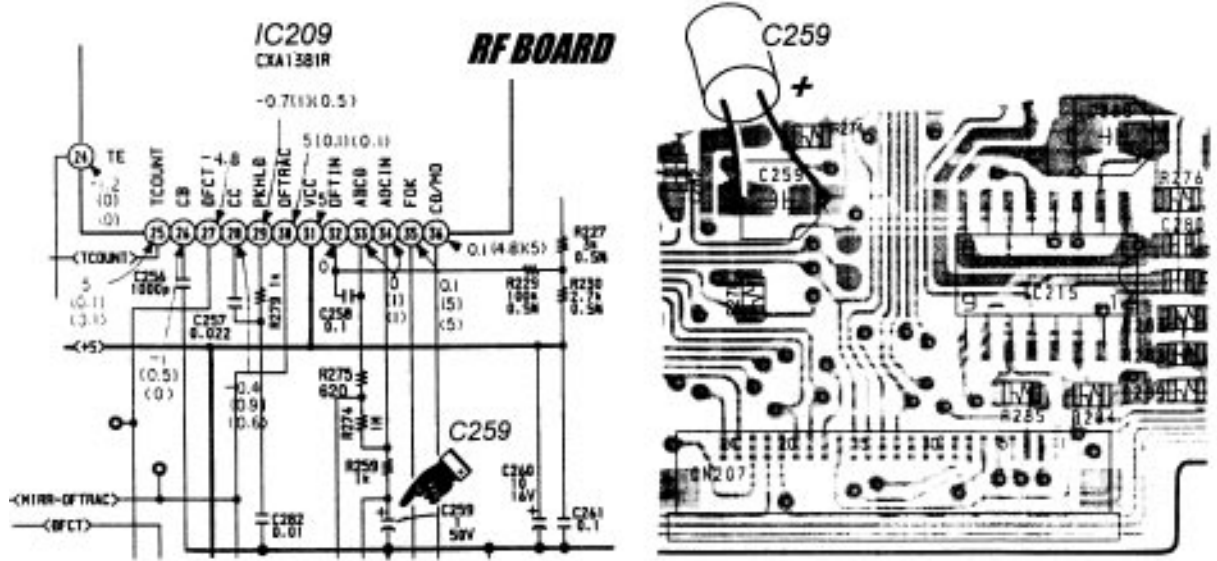

Filename: HFP0474.SB
Directory: J:\SBDOC\MAR96
Template: C:\WINWORD\TEMPLATE\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 03/25/96 10:04 AM
Revision Number: 2
Last Saved On: 03/25/96 10:04 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 1 Minute
Last Printed On: 04/01/96 9:34 AM
As of Last Complete Printing
Number of Pages: 1
Number of Words: 129 (approx.)
Number of Characters: 738 (approx.)