

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: MDS-302

No. 475

Subject: Note when replacing an Optical Block

Date: March 25, 1996


Symptom:

(62)

After replacing an optical block, two to three minutes into playing back a 74 minute MO disc, "Retry Error" will be displayed and the sound will skip.

Solution:

There are two types of Optical block assemblies. In the old type a washer was added to limit the travel of the optics on the shaft. The new type of Optical block assembly has been improved and does not require the washer. Remove the white washer (see diagram below) from the shaft when replacing an older Optical block with the new type. To distinguish the difference between the old and new optical blocks see the diagram below.

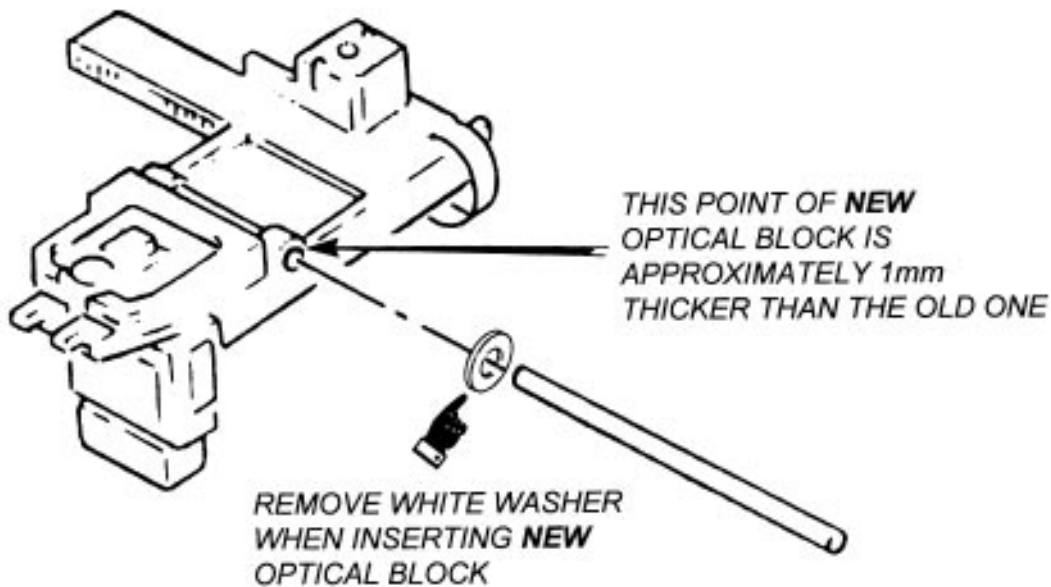

Filename: HFP0475.SB
Directory: J:\SBDOC\MAR96
Template: C:\WINWORD\TEMPLATE\S_BULL.DOT
Title:
Subject:
Author: Hoyt Wing Lee
Keywords:
Comments:
Creation Date: 03/25/96 10:08 AM
Revision Number: 2
Last Saved On: 03/25/96 10:08 AM
Last Saved By: Hoyt Wing Lee
Total Editing Time: 0 Minutes
Last Printed On: 04/01/96 9:35 AM
As of Last Complete Printing
Number of Pages: 1
Number of Words: 164 (approx.)
Number of Characters: 938 (approx.)