

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

CONFIDENTIAL



Service Bulletin Hi-Fi Products

Model:	D-335	No. 485
Subject:	Does Not Operate	Date: April 29, 1996
Symptom (12)	Does not operate.	
	Will not accept any key command and LED is	distorted.
Solution:	If this symptom occurs:	
	 Make continuity between the upper lid and the PCB ground. 1. File the pattern of power PCB (Fig-1) lightly and clean with alcohol. 2. Add a rubber cushion on the DC Jack. (Fig-2) 3. Put the upper lid and confirm the continuity between the mount screw of upper lid and the negative battery terminal. 	
	REF DESCRIPTION	PART NUMBER
	- RUBBER CUSHION	3-355-463-01
	Applicable Serial Nos: 100,001 to 251,	510
[POWER BOARD] (SIDE B) (Lean THIS AREA SING ALCOHOL AFTER FILING LIGHTLY FIG.1 CLEAN THIS AREA SING ALCOHOL AFTER FIG.1 CLEAN THIS AREA SING ALCOHOL AFTER FIG.2 CLEAN THIS AREA SING ALCOHOL AFTER FIG.2 CLEAN THIS AREA SING ALCOHOL AFTER FIG.2 CLEAN THIS AREA SING ALCOHOL AFTER FIG.2		
	CONTINUITY CH	HECK
	SHOULD BE BELOW 2 OHMS (BATTERY COMPARTMENT) RESIS BELOW	TANCE SHOULD BE W 2 OHMS REW OF UPPER LID

Reference: Tokyo Fax No. GA-95001

