

**Model:** HCD-H331, HCD-H331D, HCD-H551, HCD-H771, **No. 497**  
HCD-H771D, HCD-H881, HCD-H991AV


**Subject:** **Date:** October 23, 1996

**Symptom:**  
**(153)** Sound might be distorted when recording certain Cds. This may occur if the low frequency components on the disc exceed the capacity of the deck.


**Solution:** Replace the following components on the main board with new values.

Model No.			Former	New	Part No.
HCD-H551 -H771/D	HCD-H881 -H991AV	HCD-H331/D			
C306, C356		C327, C427	2.2 $\mu$ /50V	Short	-----
R201, R251	R201, R211	R201, R251	680 $\Omega$	15K	1-249-431-11
C202, C252	C202, C212	C202, C252	4700P	220P	1-162-286-31

**HCD-H551/H771  
(MAIN BOARD)**

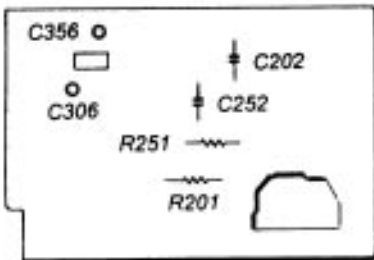

**HCD-H881/H991AV  
(MAIN BOARD)**

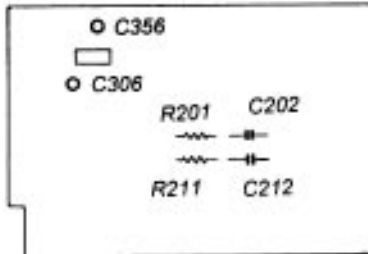

**HCD-H331  
(MAIN BOARD)**

