

Model: D-340, D-345

No. 503R1

Subject: Does Not Play Discs

Date: May 23, 1997

Symptom:

(213) Unit intermittently does not play, especially 8cm single discs.

Solution: Change the following components.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R517	CHIP RESISTOR 10K OHM	1-216-833-11	CHIP RESISTOR 18K OHM	1-216-836-11
R569	CHIP RESISTOR 150K OHM	1-216-847-11	CHIP RESISTOR 47K OHM	1-216-841-11
R609	CHIP RESISTOR 100K OHM	1-216-809-11	CHIP RESISTOR 150K OHM	1-216-811-11
C630	CHIP CAP10 pF	1-162-915-11	CHIP CAP 12 pF	1-162-916-11

The focus gain adjustment will be out of specification after changing these components. Since manual indicates that proper adjustment for RV602 is mechanical center, turn the pot counterclockwise about 30 degrees. Pot should be at "11:00".

(Cont.)



