

Model: D-140, D-141, D-141CK, D-142CK, D-143, D-144K, D-145, D-147CR

No. 504

Subject: Sound Skipping

Date: January 6, 1997

Symptom:
(257) Unit skips, even when stationary.

Solution: Replace the following component, then perform the tracking balance and gain adjustments.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R606	CHIP RESISTOR 220K OHMS	1-216-849-11	CHIP RESISTOR 1M OHMS	1-216-857-11

