

SONY[®]

Sony Service Company
National Technical Services
A Division of Sony Electronics Inc.
Park Ridge, New Jersey 07656

CONFIDENTIAL

**Service Bulletin
Hi-Fi Products**

CSA-13

Model: STR-DE305

No. 505

Subject: Incorrect FM Frequency Range

Date: January 13, 1997

Symptom:

(**)

When the unit is initially powered ON or has not been used for several weeks the FM frequency range may be incorrect.

Solution:

Reset the System Controller, IC201, by simultaneously pressing and holding the numeric buttons 4, 5 and 6 when powering the unit ON. The message "Initial" will appear in the display. In rare instances the unit will not reset using this method. Should this happen, disconnect the AC plug and short backup capacitor C201. C201 is located on the Display Board.

