

SONY[®]

Sony Service Company
National Technical Services
A Division of Sony Electronics Inc.
Park Ridge, New Jersey 07656

CONFIDENTIAL

Service Bulletin
Hi-Fi Products

CSA-13

Model: MDS-S35

No. 506

Subject: Disc Won't Eject

Date: January 13, 1997

Symptom:

(63)

The MD will not eject due to the DOOR LEVER (ref.#119) having disengaged from the LID LEVER (ref.#11).

Solution:

Replace the DOOR LEVER (4-967-657-01) and LID LEVER (4-969-213-01) with the improved part which is listed under the original part numbers.

