

Model: MZ-E3

No. 511

Subject: Display Only, No Operation

Date: January 30, 1997

Symptom:

(112) Unit powers up but sled can not move

Solution:

- I. Replace the sled motor
- II. Replace the inductors with those identified in the table
- III. Add spacer as shown in Fig 1.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
M902	SLED MOTOR	1-698-315-11		
L503, 507, 509 515, 516 801	INDUCTOR 47H	1-414-402-11		1-412-031-11
ADD			SPACER (3X3)	4-984-119-01

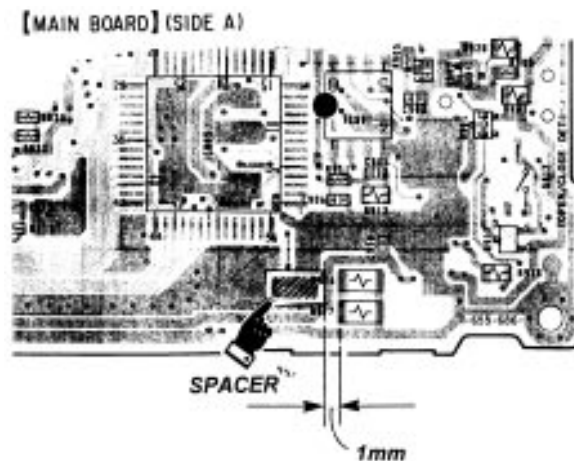


FIG.1

(Continued)



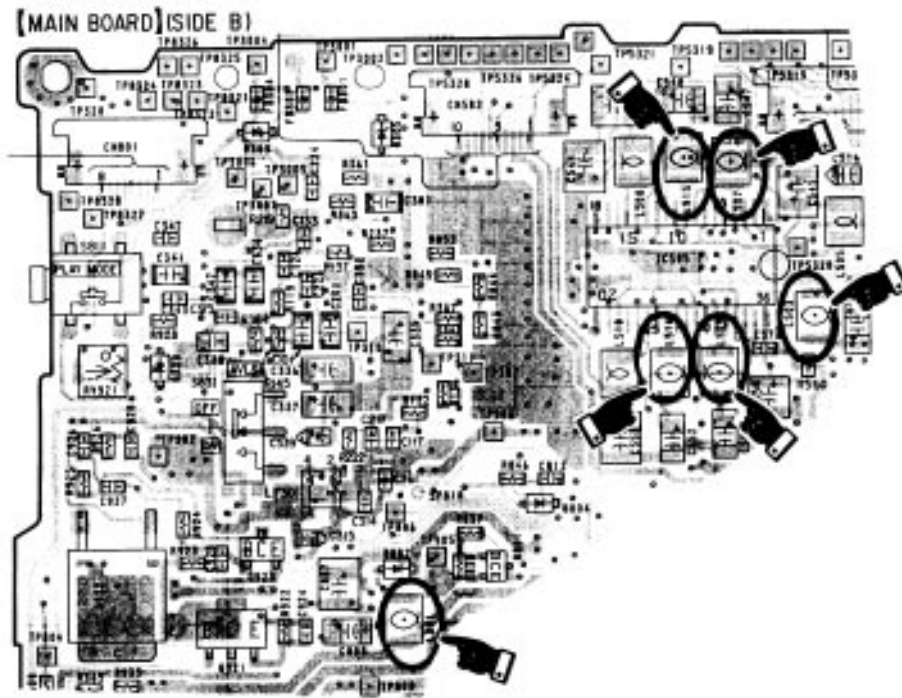


FIG.2