

Model: D-211

No. 514

Subject: IC 504 (PWM Driver) No Longer Available.

Date: January 30, 1997

Symptom:

(***) The PWM driver is no longer available

Solution:

When replacing the IC, use the chip defined below. Make sure to remove and /or replace the additional components identified.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC504	MPC1716FU	8-759-039-13	MPC1718FU	8-759-084-72
R538	1K OHM 1/16W	1-216-821-11	REMOVE	
R544	10K OHM 1/16W	1-216-833-11	REMOVE	
C563	10UF 10V	1-135-216-11	REMOVE	
C555	.001UF 50V	1-163-141-00	820PF CHIP	1-163-139-00

