

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

CONFIDENTIAL



Service Bulletin Hi Fi Products

Model: MZ-R3

No.	51	8
-----	----	---

Subject: Unit powers off during recording/ powers on Date: February 11, 1997 by itself.

Symptom:

(212) Unit will power off while in record or play back mode, or unit will power on by itself.

Solution: Replace S817 (the open switch) and change C825 as described below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
S817	SWITCH, PUSH (1 KEY)	1-572-467-31	REPLACE WITH SAME TYPE	
C825	.01UF CHIP CAP	1-164-118-11	.022UF CHIP CAP	1-115-467-11



