

**Model:** STR-GA8ES, STR-GA9ESG**No.** 521**Subject:** Noise in Rear Channels**Date:** March 5, 1997**Symptom:****(154)**

If the customer complaint is excessive noise in the rear channels perform the following procedure.

**Solution:**

Add the 100 ohm resistor as described below.

REF	DESCRIPTION	PART NUMBER
N/A	100 OHM 1/6 W RESISTOR	1-215-397-00

Cut the foil trace between pin 55 of IC401 and R407. Add the 100 ohm resistor from R413 (the side closest to IC401) to JW358. See diagram below.

