

CONFIDENTIAL

CSA-13

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

Service Bulletin Hi-Fi Products

Model: HCD-H100 No. **523R1**

Subject: The Unit Does Not Detect a Disc Date: April 14, 1997

Symptom:

(62) The unit does not detect a CD in the disc tray.

Solution: Replace I/R LED D04 (8-719-058-76) and add the following transistor in circuit to the CD Decoder Board as outlined below.

REF	DESCRIPTION	PART NUMBER
N/A	2SC945-P	8-729-194-57

Check the voltage at IC02 pin 9 on the CD Decoder Board (1/2). With a disc inserted the voltage should be less than 1.2V. When no disc is inserted the voltage should be 3.5V. If these voltages are not within the operating range, replace phototransistor PH01(8-729-036-35).

