

Sony Service Company - Technical Services  
A Division of Sony Electronics Inc.  
Sony Drive, Park Ridge, New Jersey 07656

---

**Model:** STR-D159**No.** 371**Subject:** Loss of tuner preset memory**Date:** January 27, 1994**Symptom:****(21)**

The tuners preset memory may be lost when the power is turned off after turning the volume up and down several times with the remote commander.

**Solution:**

Add a 10K resistor to pin 9 of IC601. IC601 is located on the panel board. See diagram below.





## Service Bulletin Check-Off Form

Originator: ..... Engineer Name

Diagram Location: .

<b>PERSON</b>	<b>ACTIVITY</b>	<b>INITIAL</b>	<b>DATE</b>	<b>COMMENTS</b>
Originator	Draft Creation			
Wing	Drawings & Numbering			
Originator	Proofing			
Manager	Approval			
	Notify KCP			
	AutoFlagging			
Wing	Distribution			
Rob	SDIS Entry			