

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: D-121**No.****Subject:** No Power and/or No Hold**Date:** February 2, 1994**Symptom:****(11)**

No power with AC Adaptor, no battery power, no hold.

Solution:

1. Check hold switch visually, and if it appears to be out of alignment or cold soldered, then realign and resolder hold switch (S801).
2. Pull out the DC Jack board and check it visually. If any of the traces are damaged, then replace the DC Jack board.

REF	DESCRIPTION	PART NUMBER
S801	SWITCH, SLIDE (HOLD)	1-570-397-11
	DC JACK BOARD	1-647-242-11



Service Bulletin Check-Off Form

Originator: Cesar Bechbache

Diagram Location: .

PERSON	ACTIVITY	INITIAL	DATE	COMMENTS
Originator	Draft Creation			
Wing	Drawings & Numbering			
Originator	Proofing			
Manager	Approval			
	Notify KCP			
	AutoFlagging			
Wing	Distribution			
Rob	SDIS Entry			