

Sony Service Company - Technical Services  
 A Division of Sony Electronics Inc.  
 Sony Drive, Park Ridge, New Jersey 07656

**Model:** WM-D6C

**No.** 395

**Subject:** Caution When Replacing M901

**Date:** April 29, 1996

**Symptom:**

(\*\*)

The original Motor M901 (X-3305-830-1) is no longer available, a replacement is supplied instead.

**X-3370-805-1 (MOTOR KIT)**

**Solution:**

Because the new motor is not fully compatible, the Motor Drive Circuit must be modified as indicated below. The Motor Kit includes all the components necessary to perform the modification. Proceed as follows.

1. Mount the new Motor using the supplied Brackets. Discard the original Motor Brackets (#343, 385, 387).
2. Change the values of the following on the Main Board.
3. Connect R611 and C614 in series, and solder them between pins 12 and 14 of IC601.

REF	FORMER	NEW	PART NUMBER
R608	10K	4.7K	1-249-425-11
R609	220K	470K	1-247-895-00
R610	75K	68K	1-249-439-11
R611	ADD	470	1-247-895-00
C608	2.2UF/16V	3.3UF/16V (T)	1-131-350-00
C613	0.015UF	0.0047UF (M)	1-130-479-00
C614	ADD	0.0015UF (C)	1-161-041-00

(Cont.)



