

**Model:** TA-E9000ES**No.** 628**Subject:** No Sound**Date:** April 3, 2000**Symptom:**  
**(1510)**


The customer complaints of no sound. Q108 on the powerboard may be overdissipated.

**Solution:** Replace the following components:

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R124	4.7K 1/10W	1-208-453-41	4.7K 1 W	1-215-873-11
-	-	-	100 PF	1-163-117-11

**Procedure:**Replace any defective components. Add the 100pf capacitor in parallel to R153.  
Replace R124 with the 4.7K ohm 1W resistor.

[Power Board ]

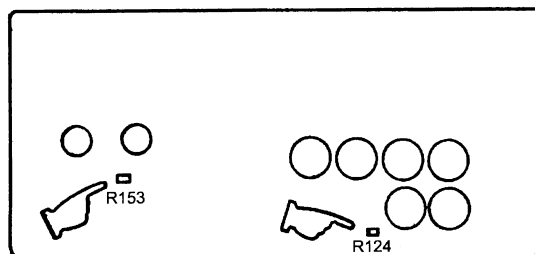

Applicable Serial Number Range:

800001 ~ 802746