

SONY®

Service Bulletin

NO: HIFI1-99-011

SUBJECT: NOISE IN SURROUND MODE

DATE: AUGUST 1999

MODEL (S): TA-E9000ES

SYMPTOM: The customer complaint states noise is heard in surround mode after the unit has been playing for awhile.

SOLUTION: Place the unit in "Cinema Studio" surround mode. Heat IC2007, 2010, and 2013 with a hot air drier for approximately three minutes. If the symptom occurs, replace all three IC's.

REF	DESCRIPTION	PART NUMBER
IC2007	IDT71V124S15	8-759-482-20
IC2010		
IC2013		

SONAM 594
AU99019

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE